

# Clarke®

# weld



## GAS/NO-GAS MIG WELDER

Models

90EN, 100EN, 105EN & 151EN

0515

## OPERATING & MAINTENANCE INSTRUCTIONS





Thank you for purchasing this CLARKE MIG Welder, designed to operate with or without gas....so-called GAS/NO-GAS welders. This is explained in greater detail within the manual.

Before attempting to operate the machine, it is essential that you read this manual thoroughly and carefully follow all instructions given. In doing so you will ensure the safety of yourself and that of others around you, and you can also look forward to the welder giving you long and satisfactory service.

## GUARANTEE

This CLARKE product is guaranteed against faulty manufacture for a period of 12 months from the date of purchase. Please keep your receipt as proof of purchase.

This guarantee is invalid if the product is found to have been abused or tampered with in any way, or not used for the purpose for which it was intended.

Faulty goods should be returned to their place of purchase, no product can be returned to us without prior permission.

This guarantee does not effect your statutory rights.

## ENVIRONMENTAL RECYCLING POLICY



Through purchase of this product, the customer is taking on the obligation to deal with the WEEE in accordance with the WEEE regulations in relation to the treatment, recycling & recovery and environmentally sound disposal of the WEEE.

In effect, this means that this product must not be disposed of with general household waste. It must be disposed of according to the laws governing Waste Electrical and Electronic Equipment (WEEE) at a recognised disposal facility.

Guarantee .....	3
Parts & Service Contacts .....	3
Electromagnetic Interference (EMC) .....	4
Safety Precautions .....	6
Additional Safety Precautions for MIG Welding .....	11
Principles of Operation .....	12
Electrical Connections .....	13
Unpacking and Parts Identification .....	14
Assembly .....	Loose Components .....
	15
	Welding Shield .....
	15
	Installing the Welding Wire .....
	16
	Selecting the Drive Roller Groove .....
	18
	Converting to Gas Supply .....
	18
Preparation for Use .....	Preparing the Work .....
	20
	Setting the Controls .....
	20
	Welding Wire Preparation .....
	21
	Attaching the Earth Lead & Clamp .....
	21
MIG Welding Operation .....	22
	Thermal Overload .....
	22
Welding Tips .....	23
Maintenance .....	23
	Renewing the Wire Liner .....
	24
Troubleshooting .....	25
Control Settings Reference Tables .....	26-28
Wiring diagrams .....	29-31
Parts Lists and Diagrams .....	32-37
Accessories .....	38
Parts & Service Contacts .....	38
Welder Specifications .....	39

# ELECTROMAGNETIC INTERFERENCE (EMC)

Whilst this unit complies with EMC regulations, the user is responsible for installing and using the welding equipment according to the manufacturers instructions. If electromagnetic disturbances are detected then it shall be the responsibility of the user of the welding equipment to resolve the situation. In some cases this remedial action may be as simple as earthing the welding circuit, see 'Note'. In other cases it could involve constructing an electromagnetic screen enclosing the power source and the work complete with associated input filters. In all cases electromagnetic disturbances must be reduced to the point where they are no longer troublesome.

**Note - The welding circuit may or may not be earthed for safety reasons. Changing the earthing arrangements should only be authorised by a person who is competent to assess whether the changes will increase the risk of injury, e.g. by allowing parallel welding current return paths which may damage the earth circuits of other equipment.**

## 1. ASSESSMENT OF AREA

Before installing welding equipment the user shall make an assessment of potential electromagnetic problems in the surrounding area. Avoid using your welder in the vicinity of:

- a) other supply cables, control cables, signalling and telephone cables; above, below and adjacent to the welding equipment;
- b) radio and television transmitters and receivers;
- c) computer and other control equipment;
- d) safety critical equipment, e.g. guarding of industrial equipment;
- e) pacemakers and hearing aids etc.;
- f) equipment used for calibration or measurement;
- g) other equipment in the environment. The user shall ensure that other equipment being used in the environment is compatible. This may require additional protection measures;

It may be possible to avoid the above by changing the time of day that welding or other activities are to be carried out.

The size of the surrounding area to be considered will depend on the structure of the building and other activities that are taking place. The surrounding area may extend beyond the boundaries of the premises.

## 2. METHODS OF REDUCING EMISSIONS

### 2.1 Mains supply

Welding equipment should be connected to the mains supply according to the manufacturers recommendations. If interference occurs, it may be necessary to

take additional precautions such as filtering of the mains supply. Consideration should be given to shielding the supply cable of permanently installed welding equipment, in metallic conduit or equivalent. Shielding should be electrically continuous throughout its length. The shielding should be connected to the welding power source so that good electrical contact is maintained between the conduit and the welding power source enclosure.

## **2.2 Maintenance of the welding equipment**

The welding equipment should be routinely maintained according to the manufacturers recommendations. All access and service doors and covers should be closed and properly fastened when the welding equipment is in operation. The welding equipment should not be modified in any way except for those changes and adjustments covered in the manufacturers instructions. In particular, the spark gaps of arc striking and stabilizing devices should be adjusted and maintained according to the manufacturers recommendations.

## **2.3 Welding cables**

The welding cables should be kept as short as possible and should be positioned close together, running at or close to the floor level.

## **2.4 Equipotential bonding**

Bonding of all metallic components in the welding installation and adjacent to it should be considered. However, metallic components bonded to the work piece will increase the risk that the operator could receive a shock by touching these metallic components and the electrodes at the same time. The operator should be insulated from all such bonded metallic components.

## **2.5 Earthing of the workpiece**

Where the workpiece is not bonded to earth for electrical safety, nor connected to earth because of its size and position, e.g. ships hull or building steelwork, a connection bonding the workpiece to earth may reduce emissions in some, but not all instances.

Care should be taken to prevent the earthing of the workpiece increasing the risk of injury to users, or damage to other electrical equipment.

Where necessary, the connection of the workpiece to earth should be made by a direct connection to the workpiece, but in some countries where direct connection is not permitted, the bonding should be achieved by suitable capacitance, selected according to national regulations.

## **2.6 Screening and shielding**

Selective screening and shielding of other cables and equipment in the surrounding area may alleviate problems of interference. Screening of the entire welding installation may be considered for special applications.

# SAFETY PRECAUTIONS FOR ALL TYPES OF WELDING

## 1. WARNING:

*As with all machinery, there are certain hazards involved with their operation and use. Exercising respect and caution will considerably lessen the risk of personal injury. However, if normal safety precautions are overlooked, or ignored, personal injury to the operator may result.*

**FAILURE TO FOLLOW THESE RULES MAY RESULT IN SERIOUS PERSONAL INJURY**

## 2. GENERAL PRECAUTIONS

### A) Burn prevention

Wear protective clothing - gauntlet gloves designed for use in welding, apron, and protective shoes. Button shirt collar and pocket flaps, and wear cuffless trousers to avoid entry of sparks and slag. Wear helmet with safety goggles or glasses with side shields underneath, appropriate filter lenses or plates (protected by clear cover glass). This is a MUST for welding or cutting, (and chipping) to protect the eyes from radiant energy and spatter. Replace cover glass when broken, pitted, or spattered. Avoid oily greasy clothing. A spark may ignite them. Hot metal such as electrode stubs and workpieces should never be handled without gloves. First aid facilities and a qualified first aid person should be available unless medical facilities are close by for immediate treatment of flash burns of the eyes and skin burns. Ear plugs should be worn when working overhead or in a confined space. A hard hat should be worn when others work overhead. Flammable hair preparations should not be used by persons intending to weld or cut.

### B) Toxic fume prevention

Severe discomfort, illness or death can result from fumes, vapours, heat, or oxygen enrichment or depletion that welding (or cutting) may produce. Prevent them with adequate ventilation. NEVER ventilate with oxygen. Lead-, cadmium-, zinc-, mercury- and beryllium-, bearing materials, when welded (or cut) may produce harmful concentrations of toxic fumes. Adequate local exhaust ventilation must be used, or each person in the area as well as the operator must wear an air-supplied respirator. For beryllium, both must be used. Metals coated with or containing materials that emit toxic fumes should not be heated unless coating is removed from the work surface, the area is well ventilated, or the operator wears an air-supplied respirator. Work in a confined space only while it is being ventilated and, if necessary, while wearing an air-supplied respirator. Vapours from chlorinated solvents can be decomposed by the heat of the arc (or flame) to form PHOSGENE, a highly toxic gas, and other lung and eye irritating products. The ultraviolet (radiant) energy of the arc can also decompose trichloroethylene and perchloroethylene vapours to form phosgene. DO NOT WELD or cut where solvent vapours can be drawn into the welding or cutting atmosphere or where the radiant energy can penetrate to atmospheres containing even minute amounts of trichloroethylene or perchloroethylene.

## C) Fire and explosion prevention

Causes of fire and explosion are:

- 1) combustibles reached by the arc, flame, flying sparks, hot slag or heated material;
- 2) misuse of compressed gases and cylinders;
- 3) short circuits.

BE AWARE THAT flying sparks or falling slag can pass through cracks, along pipes, through windows or doors, and through wall or floor openings, out of sight of the goggled operator. Sparks and slag can fly 10M.

To prevent fires and explosion: keep equipment clean and operable, free of oil, grease, and (in electrical parts) of metallic particles that can cause short circuits. If combustibles are in area, do NOT weld or cut. Move the work if practicable, to an area free of combustibles.

Avoid paint spray rooms, dip tanks, storage areas, ventilators. If the work cannot be moved, move combustibles at least 10M, away out of reach of sparks and heat; or protect against ignition with suitable and snug fitting, fire-resistant covers or shields.

Walls, ceilings, and floor near work should be protected by heat resistant covers or shields. Fire watcher must be standing by with suitable fire extinguishing equipment during and for some time after welding or cutting if:

- a) appreciable combustibles (including building construction) are within 10m.
- b) appreciable combustibles are further than 10m but can be ignited by sparks.
- c) openings (concealed or visible) in floors or walls within 10m can expose combustibles to sparks.
- d) combustibles adjacent to walls, ceilings, roofs or metal partitions can be ignited by radiant or conducted heat.

After work is done, check that area is free of sparks, glowing embers, and flames. An empty container that held combustibles, or that can produce flammable or toxic vapours when heated, must never be welded on or cut, unless container has first been cleaned. This includes.....a thorough steam or caustic cleaning (or a solvent or water washing, depending on the combustible's solubility) followed by purging and inerting with nitrogen or carbon dioxide, and using protective equipment.

Water filling just below working level may substitute for inerting.

A container with unknown contents should be cleaned (see paragraph above), do NOT depend on sense of smell or sight to determine if it is safe to weld or cut.

Hollow castings or containers must be vented before welding or cutting - they can explode.

In explosive atmospheres, never weld or cut where the air may contain flammable dust, gas, or liquid vapours.

## 3. ELECTRIC ARC (MIG, TIG) WELDING

Comply with precautions in 1 above, and this section. Arc welding, properly done, is a safe process, but a careless operator invites trouble. The equipment carries high currents at significant voltages. The arc is very bright and hot. Sparks fly, fumes rise, ultraviolet and infrared energy radiates, weldments are hot. The wise operator avoids unnecessary risks and protects himself and others from accidents.

### 3A) BURN PROTECTION

Comply with precautions in 2. The welding arc is intense and visibly bright. Its radiation can damage eyes, penetrate lightweight clothing, reflect from light coloured surfaces, and burn the skin and eyes. Skin burns resemble acute sunburn, those from gas - shielded arcs are more severe and painful.

#### **DON'T GET BURNED! COMPLY WITH PRECAUTIONS!**

#### 1) Protective clothing

Wear long sleeved clothing (particularly for gas shielded arc) in addition to such as leather jacket or sleeves, flameproof apron, and fire-resistant leggings. Avoid outer garments of untreated cotton. **Bare skin protection:** Wear dark substantial clothing, Button collar to protect chest and neck. Button pockets to prevent entry of sparks.

#### 2) Eye and head protection

Protect eyes from exposure to arc. NEVER look at an electric arc without protection. Welding helmet or shield containing a filter plate shade no. 12 or denser must be used when welding. Place over face before striking arc. Protect filter plate with a clear cover plate. Cracked or broken helmet or shield should NOT be worn; radiation can pass through to cause burns. Cracked, broken, or loose filter plates must be replaced IMMEDIATELY. Replace clear cover plate when broken, pitted, or spattered. WE SUGGEST you wear flash goggles with side shields under the helmet, to give some protection to the eyes should the helmet not be lowered over the face before an arc is struck. Looking at an arc momentarily with unprotected eyes (particularly a high intensity gas-shielded arc) can cause a retinal burn that may leave a permanent dark area in the field of vision. Before welding whilst wearing contact lenses, seek advice from your optician.

#### 3) Protection of nearby personnel

For production welding, a separate room or enclosed bay is best. In open areas, surround the operation with low reflective, non-combustible screens or panels. Allow for free air circulation, particularly at floor level. Provide face shields for all persons who will be looking directly at the weld. Others working in the area should wear flash goggles. Before starting to weld, make sure that screen or bay doors are closed.



### **3C) FIRE AND EXPLOSION PREVENTION**

Comply with precautions in 2C. Equipment's rated capacity. Do not overload arc welding equipment. It may overheat cables and cause a fire. Loose cable connections may overheat or flash and cause a fire. Never strike an arc on a cylinder or other pressure vessel. It creates a brittle area that can cause a violent rupture or lead to such a rupture later under rough handling.

### **3D) SHOCK PREVENTION**

Exposed live conductors or other bare metal in the welding circuit, or in unearthed, electrically-LIVE equipment can fatally shock a person whose body becomes a conductor. DO NOT STAND, SIT, LIE, LEAN ON, OR TOUCH a wet surface when welding, without suitable protection.

### **3E) PROTECTION FOR WEARERS OF ELECTRONIC LIFE SUPPT DEVICES (PACEMAKERS)**

Magnetic fields from high currents can affect pacemaker operation. Persons wearing electronic life support equipment (pacemaker) should consult with their doctor before going near arc welding, gouging, or spot welding operations.

### **3F) TO PROTECT AGAINST SHOCK:**

Keep body and clothing dry. Never work in damp area without adequate insulation against electrical shock. Stay on a dry duckboard, or rubber mat when dampness or sweat can not be avoided. Sweat, sea water, or moisture between body and an electrically LIVE part - or earthed metal - reduces the body surface electrical resistance, enabling dangerous and possibly lethal currents to flow through the body.

#### **1) Earthing the equipment**

When arc welding equipment is earthed according to the National Electrical Code, and the workpiece is earthed, a voltage may exist between the electrode and any conducting object.

Examples of conducting objects include, but are not limited to, buildings, electrical tools, work benches, welding power source cases, workpieces, etc. Never touch the electrode and any metal object unless the welding power source is off. When installing, connect the frames of each unit such as welding power source, control, work table, and water circulator to the building earth.

Conductors must be adequate to carry earth currents safely. Equipment made electrically LIVE by stray current may shock, possibly fatally. Do NOT EARTH to electrical conduit, or to a pipe carrying ANY gas or a flammable liquid such as oil or fuel.

#### **2) Electrode holders**

Fully insulated electrode holders should be used. Do NOT use holders with protruding screws or with any form of damage.

#### **3) Connectors**

Fully insulated lock-type connectors should be used to join welding cable.

#### 4) Cables

Frequently inspect cables for wear, cracks and damage. IMMEDIATELY REPLACE those with excessively worn or damaged insulation to avoid possibly lethal shock from bared cable. Cables with damaged areas may be taped to give resistance equivalent to original cable. Keep cable dry, free of oil and grease, and protected from hot metal and sparks.

#### 5) Terminals and other exposed parts

Terminals and other exposed parts of electrical units should have insulating covers secured before operation.

#### 6) Electrode

##### a) Equipment with output on/off control (contactor)

Welding power sources for use with the gas metal arc welding, gas tungsten arc welding and similar processes normally are equipped with devices that permit on/off control of the welding power output. When so equipped the electrode wire becomes electrically LIVE when the power source switch is ON and welding gun switch is closed. Never touch the electrode wire or any conducting object in contact with the electrode circuit unless the welding power source is off.

##### b) Equipment without output on/off control (no contactor)

Welding power sources used with shielded metal arc welding and similar processes may not be equipped with welding power output on/off control devices. With such equipment the electrode is electrically LIVE when the power switch is turned ON. Never touch the electrode unless the welding power source is off.

#### 7) Safety devices

Safety devices such as interlocks and circuit breakers should not be disconnected or shunted out. Before installation, inspection, or service of equipment, shut OFF all power and remove line fuses (or lock or red-tag switches) to prevent accidental turning ON of power. Do not open power circuit or change polarity while welding. If, in an emergency, it must be disconnected, guard against shock burns, or flash from switch arcing. Always shut OFF and disconnect all power to equipment. Power disconnect switch must be available near the welding power source.

## PREPARATION OF THE WORKING AREA

The working area must be sufficiently spacious, not humid, and well-ventilated as to avoid any fumes which develop from the welding process and from incidental material adhering to the pieces to be welded (oils, paints, tars...) which may cause annoyance to the operator.

Avoid welding by contact with humid parts nearby combustible liquids. Least of all, do not weld upon tanks which may contain flammable residuals.

## ADDITIONAL SAFETY PRECAUTIONS for MIG WELDING

- **ALWAYS** ensure that there is full free air circulating around the outer casing of the machine, and that the louvres are unobstructed.
- Welding arc can seriously damage your eyes. Both operator and spectators must **ALWAYS** use a proper welding face shield or helmet, with suitable filter lenses. Proper gloves and working clothes should be worn at all times.
- **ALWAYS** inspect the hose before use to ensure it is in good condition.
- **ALWAYS** keep the free length of gas hose outside the work area.
- **ALWAYS** remove all flammable materials from the welding area.
- **ALWAYS** Keep fire extinguisher handy..... **'Dry Powder, CO<sub>2</sub> or BCF, NOT Water**
- **NEVER** remove any of the panels unless the machine is disconnected from the supply, AND never use the machine with any of the panels removed.
- **NEVER** attempt any electrical or mechanical repair unless you are a qualified technician. If you have a problem with the machine contact your local CLARKE dealer.
- **NEVER** use or store in a wet/damp environment. DO NOT EXPOSE TO RAIN.
- **NEVER** continue to weld, if, **at any time**, you feel even the smallest electric shock. Stop welding IMMEDIATELY, and DO NOT attempt to use the machine until the fault is diagnosed and corrected.
- **NEVER** point the MIG torch at any person or animal.
- **NEVER** touch the MIG torch nozzle until the welder is switched OFF and the nozzle has been allowed to cool off.
- **NEVER** connect, disconnect, or attempt to service the MIG torch, until the machine is switched OFF and disconnected from the mains supply.
- **NEVER** allow the cables to become wrapped around the operator or any person in the vicinity.

If you convert your welder to operate with gas, observe the following precautions

- **NEVER** expose the gas cylinder to high temperatures
- **NEVER** strike an arc near the gas cylinder

## SAFETY EQUIPMENT

A comprehensive range of CLARKE safety equipment for use when welding is available from your local dealer.

## NO-GAS MIG WELDING - PRINCIPLES OF OPERATION

MIG (Metal Inert Gas) welding is a process in which a power wire electrode is fed continuously into the weld pool at a controlled, constant rate.

The wire is connected to the positive side of a rectified voltage supply. The workpiece is connected to the **negative** side of the supply (NO-GAS Welding).

When the wire is fed, it comes into contact with the workpiece and an arc is struck. The arc melts the wire and the material, fusing it together.

The wire, which is fed by the wire feed motor is fed into the weld pool, burning itself off at a rate dependent upon the selected wire feed speed.

To protect the weld pool from oxidation and impurities during the welding process, a shielding gas flows over and around the weld pool. This gas flow is provided by a flux core within the welding wire electrode. The flux melts due to the heat produced, giving off a gas. This gas prevents oxygen, in the surrounding air, from coming into contact with the molten pool at a critical time. Solidification takes place, creating a much stronger, cleaner weld, free of impurities.

This range of welders may be converted to use gas bottles, essential when welding aluminium, stainless steel etc. Please refer to the note on page 19.

## BENEFITS OF MIG WELDING

- Better outdoor use as wind has less chance of disturbing the gas shroud.
- 50% faster welding time.
- There is no slag removal, thus eliminating almost all post-welding cleaning operations.
- Overall, a faster more efficient way of getting the job done.
- Less heat - less distortion.
- Ability to weld thin material.

### **NO-GAS welding additionally allows for :**

- Operator training time kept to a minimum
- No need for short life gas bottles
- Outdoor use is easier as wind or breeze has less chance of blowing away the gas cloud.

# ELECTRICAL CONNECTIONS

 **WARNING! THIS APPLIANCE MUST BE EARTHED.**

These welders are fitted with a standard 13 amp BS 1363 plug, fitted with a 13 amp fuse. Connect to a 230 volt (50Hz) domestic electrical supply and **we strongly recommend that this be done via a Residual Current Device (RCD).**

**IMPORTANT: If the welder is fitted with a plug which is moulded onto the electric cable (i.e. non- re-wirable) please note:**

1. The plug must be thrown away if it is cut from the electric cable. There is a danger of electric shock if it is subsequently inserted into a socket outlet.
2. Never use the plug without the fuse cover fitted.
3. Should you wish to replace a detachable fuse carrier, ensure that the correct replacement is used (as indicated by marking or colour code). Replacement fuse covers can be obtained from your local dealer or most electrical stockists.

## Fuse Rating

The fuse in the plug must be replaced with one of the same rating (**13 amps**) and this replacement must be ASTA approved to BS1362.

**IMPORTANT: The wires in the mains lead are coloured in accordance with the following code:**

*Green & Yellow ..... Earth*  
*Blue ..... Neutral*  
*Brown ..... Live*

As the colours of the flexible cord of this appliance may not correspond with the coloured markings identifying terminals in your plug, proceed as follows:

- Connect GREEN & YELLOW cord to plug terminal marked with a letter "E" or Earth symbol "⏚", or coloured GREEN or GREEN & YELLOW.
- Connect BROWN cord to plug terminal marked letter "L" or coloured RED.
- Connect BLUE cord to plug terminal marked letter "N" or coloured BLACK.

## Extension Cable

If an extension cable is fitted, ensure the minimum cross section of the conductor is 1.5mm<sup>2</sup> for up to 15 metres in length, and 2.5mm<sup>2</sup> for up to 25 metres.

## UNPACKING & PARTS IDENTIFICATION

Unpack and lay out the components, checking against the following list. Any damage or deficiency should be reported to your CLARKE dealer immediately.

**Most of the components are stored within the side compartment.** To open the compartment, pull the side panel up sharply.

The cover may be quite tight when new, so exercise a little care.

### MIG 90EN,105EN & 110EN

1. Rubber Feet with washers and screws (4 pcs)
2. 2-Piece Welding Mask
3. Welding Mask handle, complete with plastic nut and 2xplastic screws.
4. Package containing 1x Clear Glass and 1x Dark Glass Lens
5. Flux cored Wire Spool
6. Spare welding tip (1 pc)

### MIG151EN

1. Foot with screw and washer
2. Wheels with retaining clips (2 pcs)
3. Axle
4. Spare welding tips (2 pcs)
5. 2-Piece Welding Mask
6. Welding Mask handle, complete with plastic nut and 2xplastic screws.
7. 1xPackage containing 1x Clear Glass and 1x Dark Glass Lens
8. Flux cored Wire Spool



# ASSEMBLY & INSTALLATION

## A. LOOSE COMPONENTS

### MIG's, 90EN, 100EN & 105EN

Lay the welder gently on its side and attach the four feet using the screws and flat washers provided.

### MIG 151EN only

Insert the axle through the holes in the rear base of the machine, then attach the wheels, securing them by pushing the star locking washers provided, on to the axle, using a piece of tube or an old socket, ensuring the centre tines of the washer face outwards.


Lay the machine gently on its side and attach the foot to the front base using the screw and washer provided.

Attach the handle to the top of the machine by slotting it into place and securing with the screws provided. Slide the handle extension into the handle and secure with the screw provided.

The gas bottle is secured to the machine using the large worm drive fastening band which is threaded through the opening provided on the rear panel of the machine.

## B. THE WELDING SHIELD

1. Push the two halves of the shield together as shown.
2. Place the handle into position and secure using the plastic screw and clip provided
3. Working from the inside of the shield, insert the clear glass panel into the recess in the shield, followed by the dark glass panel.
4. Secure the glass panels with the lens surround and plastic screws/clips provided. The clear glass MUST be on the outside of the shield.
5. Finally use the last plastic screw and clip as shown to fix the two halves of the shield together.

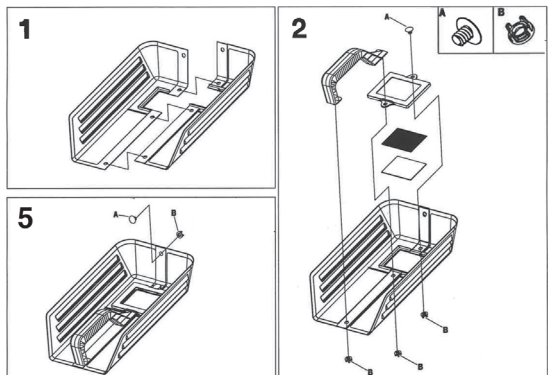

### WARNING:

**NEVER look at an electric arc without eye protection as this can injure the eyes permanently. ALWAYS use a protection mask or welding helmet.**

## C. INSTALLING THE WELDING WIRE

**NOTE:** These machines are supplied with a Clarke 'Mini' spool of mild steel flux cored welding wire. A 5kg spool is available from your Clarke dealer. See 'Accessories' for full details.

1. **IMPORTANT:** Ensure that the electrical supply is disconnected.
2. Firstly remove the side cover, on the left hand side of the unit, by pulling it sharply upwards.

### (1) Removing/Replacing the Wire Spool


If the wire spool is mounted on the spool holder, it needs to be removed in order to remove the plastic wrapper. To do this, proceed as follows:

Unscrew and remove the plastic knob (A), followed by the spring and collar (B) from the hub.

Remove the plastic wrapper then slide the spool back over the hub, ensuring that it sits snugly, and replace the collar, spring and plastic knob, tightening it sufficiently to allow the spool to rotate smoothly but with a slight amount of braking friction.

Do not over tighten as this will exert undue pressure on the wire drive motor and may cause serious damage.

Fig.3

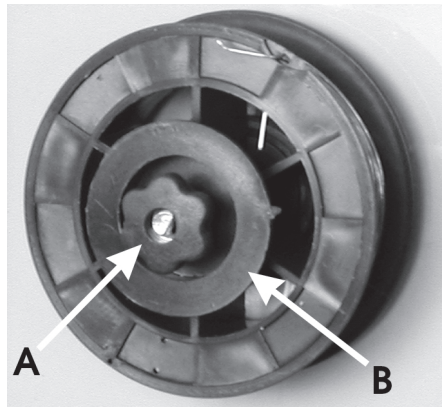


### (2) Threading the Welding Wire

Fig.4

Re: Fig.4

1. Loosen the plastic knob (A) by turning it anticlockwise, (this device maintains pressure on the wire).
2. Pull, on the plastic knob, so that the screw rod hinges out of its slot. This releases the pivoted pressure roller bracket (C). Raise the bracket, in the direction of the arrow, and pull out any wire that has been left in the wire liner (D), pulling it from the nozzle end of the hose.

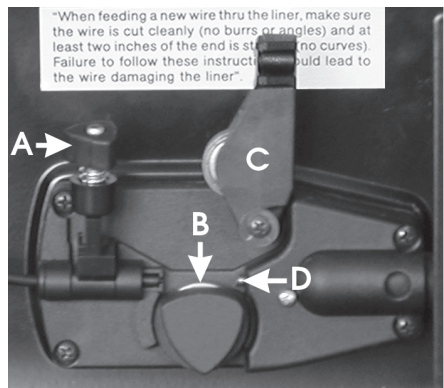



**IMPORTANT!**


*If you are changing the size of wire, you must also select the appropriate groove on the feed roller. See p. 19*

**3. Re: Fig.5**

Pull out the end of the wire from the rim of the spool, taking care NOT to release it. The spool is wound firmly and should remain this way.

Ensuring the wire is straight and not kinked in any way, clip off the end cleanly, ensuring there are no burrs or sharp edges.

Proceed to feed it through the guide tube (E), over the groove on the roller (B), and into the wire liner (D), by about 10 - 15 cm.

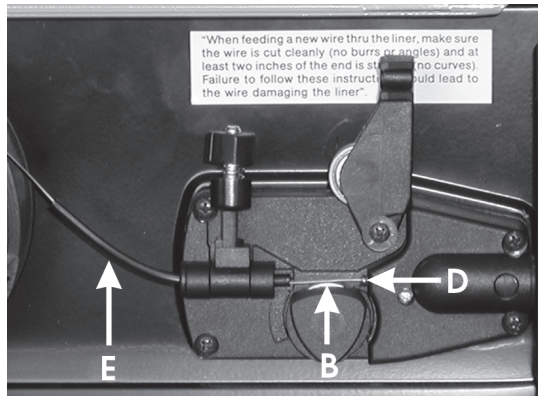

4. Reposition the pressure roller bracket (C, FIG.4) and plastic knob (A, Fig.4) and tighten slightly.


**CAUTION:**

*Tightening the knob (A) too tightly will crush the wire and damage the wire feed*

**5. (Ref. Fig 6)**

Unscrew and pull off the torch shroud by twisting it anti clockwise, then unscrew the contact tip.

6. Close the side panel of the machine, plug into a 230V, 50HZ outlet (or switch on isolator), switch on the machine and press the trigger.

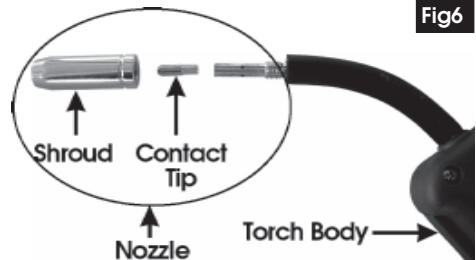

The wire will feed through the hose and when it appears at the torch end, release the trigger, switch off the machine and disconnect the machine from the mains supply. Replace the contact tip and the torch shroud.

**IMPORTANT:**

*Ensure the hose is kept straight during this operation, to assist the wire as it is fed through to the wire liner and contact tip.*

### (3) Selecting the Correct Drive Roller Groove

As previously mentioned, it is important that the correct groove in the drive roller is selected for the particular wire being used. Two grooves, 7mm and 9mm are provided.


The 7mm groove should be used with 6mm dia. wire and the 9mm groove for all 8mm wire and 9mm flux cored wire. The welder s factory set with the 9mm groove in position.

To change to the other groove, proceed as follows:

**Fig.7**

1. With the pressure roller bracket raised, and the old wire removed, as shown, turn the roller securing knob (A), fully anticlockwise, as indicated in Fig.7, and pull it from the shaft, followed by the roller.

Turn the roller through 180°, replace it on the shaft, followed by the securing knob, which should then be turned fully clockwise to lock the roller securely in place.

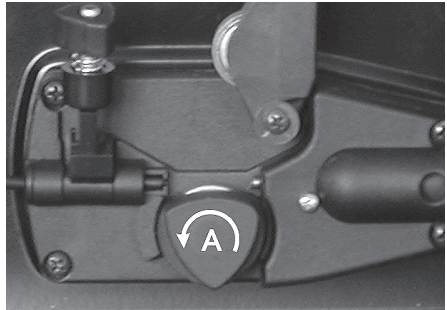

## D. CONVERTING TO GAS WELDING

For welding stainless steel or aluminium, it is necessary to convert your NO-GAS machine to GAS operation. This is a simple process once you have purchased the following parts, readily available from your **Clarke** dealer.

### 1. Welding Wire

Either Mini or 5kg wire spools, at 0.6mm or 0.8mm diameter. (See Accessories)

### 2. Contact Tips

The appropriate tip must be used to suit the thickness of wire being used. i.e., 8mm wire requires a 0.8mm tip and 0.9mm wire requires a 1.0mm tip.

### 3. Gas Regulator

This is available from your **Clarke** dealer.

**NOTE: Decide in advance whether you are going to use disposable or rechargeable gas bottles as this will effect the type of regulator purchased. Consult your Clarke dealer**

### 4. Gas

Disposable gas bottles are available from your **Clarke** dealer, or rechargeable bottles from your welding supply shop.

**SEE ALSO THE NOTES ON PAGE 21 - ATTACH THE EARTH LEAD**

Always use the appropriate gas for the material being welded. Three types are provided by Clarke International, as follows:

<i>Carbon Dioxide (CO<sub>2</sub>)</i> .....	<i>For Mild Steel</i> .....	<i>Part No. 6000642</i>
<i>Argon</i> .....	<i>For Aluminium</i> .....	<i>Part No. 6000661</i>
<i>CO<sub>2</sub>/Argon Mix</i> .....	<i>For Thin Sheet metal</i>	
	<i>Mild Steel/ Stainless</i> .....	<i>Part No. 6000660</i>
<i>Additionally a larger CO<sub>2</sub> bottle is available</i> .....	<i>Part No. 6000643</i>	
<i>Replacement Gas Regulator</i> .....	<i>Part No. 8132000</i>	

## Attaching Gas Bottle and Regulator

1. If using disposable gas bottles remove the protective plastic cap from the threaded top of the bottle and screw the regulator (F) down in a clockwise fashion until tight (be careful not to put too much force on the regulator when tightening).
2. Insert the plastic gas tube into the regulator (push all the way in). Note: when changing disposable bottles, push in the outer flange of the regulator orifice to allow easy release of the plastic tube.

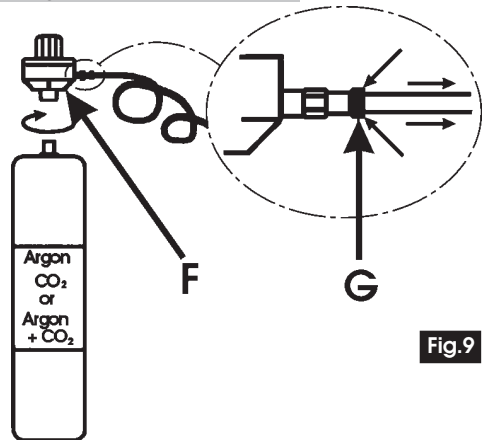


Fig.9

3. The operation of the pressure regulator, for use with disposable bottles, is based on the action of a needle operated by a knob placed over a graduated dial plate (from "0" to "6"), acting on the valve of the bottle. With the knob turned to position "0" there is no gas flow; before starting to weld bring the knob to position "3" or "4", achieving a gas flow of 2/3 litres/minute. In order to obtain the maximum service from each gas bottle, always maintain a minimum gas flow (2/3 litres per minute) which is sufficient to obtain a good weld without porosity. The pressure regulator is equipped with a safety valve which will automatically operate should the pressure surge.
4. For safety and economy, ensure that the regulator is fully closed (turning fully anti-clockwise) when not welding and/or before fitting or removing the gas bottle.
5. When using a rechargeable bottle insert the plastic gas tube into a large gas bottle adaptor. Connect the tail end of the adaptor to a length of 1/4" (6 mm.) dia. flexible gas pipe and connect this pipe to a gauged pressure regulator which is screwed onto the rechargeable bottle. The gauged pressure regulator is then used to control the flow of gas which should be XXX litres per minute.

# PREPARATION FOR USE


## A. PREPARE THE WORK

### **MOST IMPORTANT!**

It is VITAL that the workpiece is perfectly clean at the point of weld. Any coating, plating or corrosion MUST be removed, otherwise a good weld will be impossible to achieve.

## B. SET THE CONTROLS

In order to produce a satisfactory weld, the controls must be fine tuned whenever there is a material change in weld characteristics.

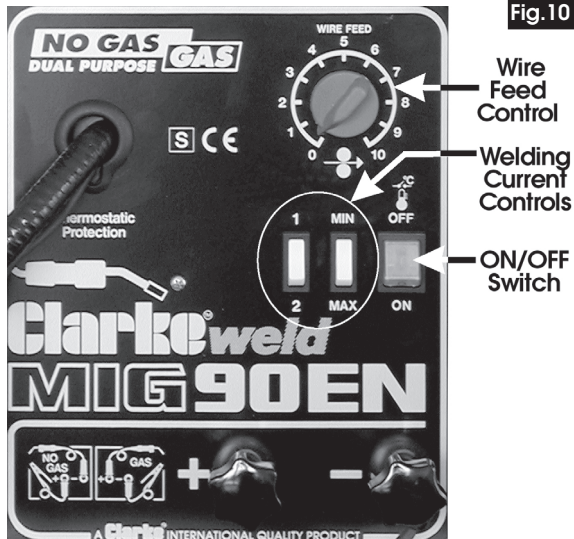

**Fig.10**

**Three sets of controls are provided....**

### **(i) ON/OFF,**

The ON/OFF switch is self explanatory, but serves a secondary function. You will note that it is coloured amber. The switch doubles as a lamp, which will illuminate if the Thermal Overload intervenes. (See Thermal Overload on page 23)

### **(ii) WIRE FEED SPEED CONTROL.**

The WIRE FEED Rotary Control Knob, with graduations from 0 to 10, is used to control the wire speed feed to the nozzle.

The knob should be set to position 6 to begin with for welding steel, and 8 for welding aluminium, then adjusted as required. (See notes under 'Operation')

**Note: This control is for fine tuning the wire speed. The speed of wire delivery will increase automatically as the current is increased and vice versa. Therefore, once the ideal speed is achieved by fine tuning, it should not be necessary to adjust this control when the welding current is changed.**

### **(iii) WELDING CURRENT CONTROLS**

Controls differ from model to model and are described as follows:

Models 90EN, 1010EN and 105EN are provided with two, 2-position switches marked 1- 2 and MAX - MIN respectively, as shown in Fig 10. Model 150EN is provided with three 2-position switches, marked A-1, 2-3 and MAX-MIN.

These controls are used to control the welding current according to the type and thickness of material to be welded, and in accordance with the charts shown in the 'Reference Tables' on pages 26-28. Set the switches accordingly, and fine tune the controls as described under 'Operation', to produce a satisfactory weld.

### C. Trim the Welding Wire

Trim the welding wire so that it protrudes no more than 5mm from the end of the shroud.

### D. Attach the Earth Lead & Clamp

#### 1. NO-GAS WELDING

For NO-GAS welding to take place, the earth cable MUST be connected to the POSITIVE terminal, and the torch lead to the NEGATIVE terminal, as shown in FIG. 11

Fig.11



#### 2. GAS WELDING

For GAS welding to take place, the earth cable MUST be connected to the NEGATIVE terminal, and the torch lead to the POSITIVE terminal, i.e. in reverse to that shown in Fig.11 above.

Attach the earth lead to the workpiece with the earth clamp, **as close to the point of weld as possible**, without it being intrusive.

**Ensure there is good contact, if necessary, clean the area with a wire brush beforehand....Remember, the contact MUST be on bare metal - thoroughly clean.**

**IMPORTANT**  
The machine is set up at the factory for use with Flux Cored Welding Wire.... i.e. NO-GAS WELDING.

***Your welder is now fully prepared for welding.***

## OPERATION

With the welding current set, and welding wire trimmed, set the wire feed control to 6, (8 for Aluminium). Plug the machine into the mains supply or switch on at the isolator and ensuring all precautions have been taken and with the machine set up correctly, lower the torch to the workpiece with one hand, whilst holding the welding mask in the other.

Approach the work with the tip at an angle of approx. 45° and pull the torch trigger fully. A welding current is now available at the tip.

As the electrode touches the workpiece, an arc will be struck.....**BEFORE** it is struck, cover the face with the face mask.

Maintain a gap of approx. 5 - 7mm from the workpiece to the tip, and feed the wire into the molten pool at a steady rate, along the line of the proposed weld.

The speed of weld will depend upon the wire speed and welding current.

### **NOTES:**

***As MIG welding is an acquired skill, it is strongly advised that, if you are not fully familiar with this type of welding, you practise on a piece of material with the same characteristics as that of your workpiece until you are satisfied with the result, and you have fine tuned your welder to produce a satisfactory weld.***

***One of the problems experienced with novice welders, is the welding wire sticking to the contact tip. This is as a result of the wire feed speed being too slow. It is always better therefore to start with too high a speed, and back off slightly, to avoid the possibility of the wire welding itself to the tip. This is the reason position 6 is recommended for start up.***

***The Wire Feed control is for fine tuning the wire speed. The speed of wire delivery will increase automatically as the current is increased from MIN to MAX, and vice versa. Therefore, once the ideal speed is achieved, by fine tuning, it should not be necessary to adjust this control when the welding current is changed.***

***Listen to the sound made. An irregular crackling sound denotes too high a wire speed. Decrease the speed until a regular, strong buzzing sound is heard.***

## THERMAL OVERLOAD

Should the welder suddenly cut out during operation, it is possible that the thermal overload has intervened.

The thermal overload is a safety device which shuts off the welder when the duty cycle has been exceeded. This is to prevent damage to the machine caused by overheating.

When this occurs, the ON/OFF switch will glow (amber). Allow the welder to cool, until the amber light extinguishes before resuming.

For details of the duty cycle...i.e. the length of time the machine may be used continuously, refer to the data and notes on page 29.

## WELDING TIPS

- Try to maintain the tip of the nozzle at an angle of approx. 45° and at a constant distance of approx 5-7mm from the workpiece.
- Try to maintain a constant speed of movement with the torch.
- Do not weld in windy conditions or in an area where ventilation is a problem, or where air flow fluctuates.
- ALWAYS keep the wire and nozzle clean...NEVER use rusted wire.
- Avoid sharp bends or kinks in the welding hose.
- Periodically remove the dust, using LOW PRESSURE compressed air, within the casing. Adequate heat dissipation is essential during the welders operation.

## MAINTENANCE

Frequency of maintenance operations depends on the operating conditions, how intensively the welder is used, and how clean or dirty the welding site is (aggressive atmospheres, etc).

Always inspect the cables, both earth return and torch cable, before use to ensure they are in perfect condition.

Ensure the earth clamp is clean and secured correctly to the cable.

Check the gas hose for security and serviceability.

As a general rule the power supply should be inspected internally at least annually. Consult your CLARKE dealer



### WARNING!

**ELECTRICITY CAN KILL**

**NEVER TOUCH LIVE ELECTRICAL COMPONENTS  
DISCONNECT THE POWER SUPPLY BEFORE ALL INSPECTIONS AND  
MAINTENANCE OPERATIONS**

**BEWARE HOT SURFACES.....ALWAYS LET THE POWER SUPPLY COOL DOWN  
BEFORE ACCESSING INTERNAL COMPONENTS.**

## WELDING SHIELD

Always maintain the welding mask in good condition. If the clear glass protection lens becomes badly pitted, sufficient to interfere with vision, or cracked, have it replaced immediately.

Replacement clear and dark lenses are available from your Clarke dealer - see Parts Lists for details. NEVER use any dark filter lens other than that provided by CLARKE International, or one with the same certified 'Optical class' (degree of protection).

The shield should always be cleaned with a clean soft cloth after use, ensuring the lenses are clean. Remove any dust that may have accumulated and store it in a safe place where it cannot be damaged.

NEVER use a shield that is **not** in perfect condition.



## RENEWING THE WIRE LINER

Fig.12

If the liner becomes damaged or kinked, it will be necessary to replace it.

Before commencing work, ensure the gas and electrical supplies are disconnected.

1. Open the side cover, and remove the welding wire from the hose and torch assembly. (Refer to 'Installing Welding Wire' on page 16).
2. Slacken the three screws (W), securing the Hose Support Bracket Cover, slightly...do not remove.
3. Remove the Roller (D)
4. Holding the torch on its side on a flat surface, carefully remove the five securing screws, and gently prise off the uppermost cover, taking care not to disturb the components within, so that you can take note of the exact manner in which they are located, particularly the contact spring (E).


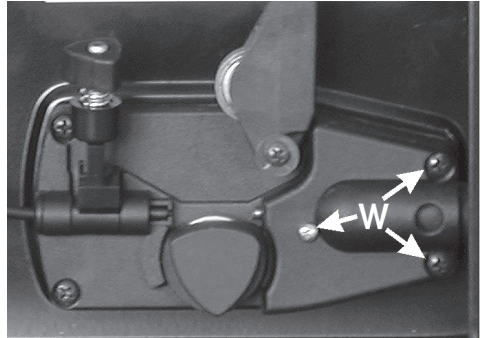


Fig.13



5. Lift out the gas valve (F), and unscrew the liner (H) using a 5/16" spanner on nut (J).
6. Straighten the hose assembly and pull the liner completely out of the hose.
7. Thread the new liner into the hose from the torch end, so that it passes through the Hose Support Bracket Assembly, then connect it to the gas valve and tighten.
8. Reassemble the torch, taking care to ensure that the contact spring (E) and the gas valve (F) are correctly seated. Note that a dowel is used to locate the two halves of the handle. Ensure it is correctly lined up before tightening the five securing screws.
9. Pull the hose so that it is as straight as possible, and leave in this position whilst you retighten the Hose Support Bracket Cover screws (W).
10. Replace the roller on the shaft, where it will butt up against the wire liner. Very carefully, snip off the end of the liner so that a gap of approximately 2-3mm max. exists between the end of the wire liner and the roller. There must be no burrs which could impede the progress of the welding wire. Ensure you use a sharp pair of snips.
11. Push the Roller fully home and secure with the securing knob.

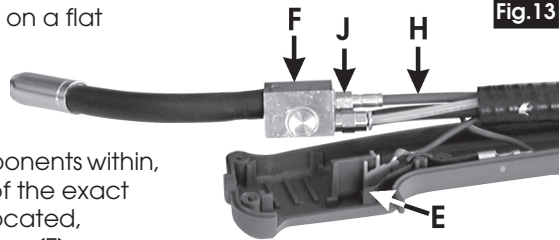

# TROUBLESHOOTING

Your **Clarke** Mig Welder has been designed to give long and trouble free service. If, however, having followed the instructions in this booklet carefully, you still encounter problems, the following points should help identify and resolve them.

PROBLEM	CAUSE	REMEDY
1. No "life" from welder	Check fuses and mains lead	a) Replace fuses as necessary If problem persists return welder to your local dealer b) Check fuse size
2. No wire feed	Motor malfunction	Return welder to your local dealer
3. Feed motor operates but wire will not feed	a) Insufficient Feed Roller Pressure b) Burr on end of wire c) Liner blocked or damaged  d) Inferior wire e) Roller worn out	a) Increase roller pressure b) Re-cut wire square with no burr c) Clean with compressed air or replace liner. d) Use only good "clean" wire e) Replace roller
4. Wire welds itself to tip	a) Wire feed speed too low  b) Wrong size tip	a) Unscrew tip, cut wire and fit new tip Increase wire speed before operating again b) Fit correct size tip
5. Wire feeds into 'birds nest' tangle	a) Wire welded to tip  b) Wire liner damaged preventing smooth operation	a) As above plus reduce feed roller pressure so that if blockage occurs wire slips on roller i.e. no feed b) Renew wire liner
6. Loose coils of wire tangle around wire drum inside machine	Drum brake too slack	Tighten drum brake Caution: Do not over-tighten
7. Erratic wire feed	a) Drum brake too tight b) Feed roller worn c) Insufficient pressure on feed roller  d) Wire dirty, rusty, damp or bent e) Liner partially blocked	a) Loosen drum brake slightly b) Check and replace if necessary c) Increase pressure on feed roller Caution: Do not over-tighten d) Re-cut wire and ensure it is clean e) Clean with compressed air
8. Poor quality welds	a) Insufficient gas at weld area  b) Incorrect gas/wire combination  c) Rusty, painted, damp, oil or greasy workpiece d) Rusty/dirty wire e) Poor earth contact	a) Check that gas is not being blown away by draughts and if so move to more sheltered weld area. If not increase gas supply b) Consult your MIG welding manual for correct set-up c) Ensure workpiece is clean and dry d) Ensure wire is clean and dry e) Check earth clamp/workpiece conn
9. Wire jams in tip when welding aluminium	Tip too small	Use slightly oversize tip i.e., for .8mm wire use 1mm tip. (Note: Applies to aluminium only)
10. Welder cuts out whilst in use	Duty cycle exceeded (auto cut-out operates)	Allow welder to cool 15-30 mins before continuing <i>Note: If duty cycle is continually exceeded, damage to the welder may result, and welder output is probably too small for application</i>

If you have any problems which cannot be resolved by reference to the above, or if you require spare parts for your welder please contact your local Clarke dealer.

# CONTROL SETTINGS - REFERENCE TABLES


## A. MIG 90EN

STEEL	0.6 mm Gas Welding Wire			0.8 mm Gas Welding Wire			
	Workpiece Thickness (mm)	Welding Position		Wire Speed Adjustment	Welding Position		Wire Speed Adjustment
		<b>A</b>	<b>B</b>	<b>C</b>	<b>A</b>	<b>B</b>	<b>C</b>
0.6 - 0.8	1	MIN	5	1	MIN	5	
0.8 - 1.0	2	MIN	6	2	MIN	6	
1.0 - 2.0	1	MAX	6	2	MAX	6	
2.0 - 3.0	2	MAX	7-8	2	MAX	7-8	

ALUMINIUM	0.8 mm Gas Welding Wire		
Workpiece Thickness (mm)	Welding Position		Wire Speed Adjustment
	<b>A</b>	<b>B</b>	<b>C</b>
0.8	1	MIN	7-8
1.0 - 2.0	2	MIN	7-8
2.0 - 3.0	2	MAX	9

## NO GAS

SOFT STEEL	0.9 mm Gas Welding Wire		
Workpiece Thickness (mm)	Welding Position		Wire Speed Adjustment
	<b>A</b>	<b>B</b>	<b>C</b>
0.6 - 0.8	1	MIN	5-6
0.8 - 1.0	2	MIN	5-6
1.0 - 1.2	2	MAX	6
1.2 - 2.0	2	MAX	7-8

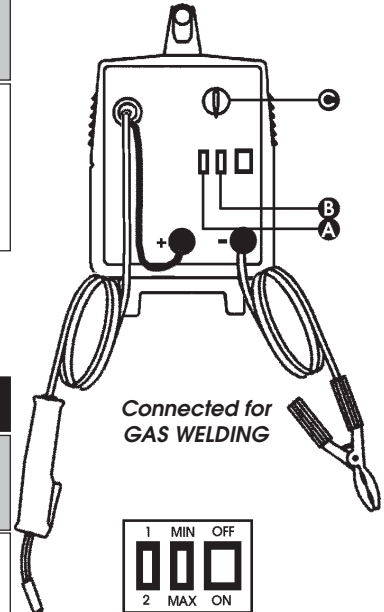

# CONTROL SETTINGS - REFERENCE TABLES


## B. MIGs 100EN & 105EN

STEEL	0.6 mm Gas Welding Wire			0.8 mm Gas Welding Wire			
	Workpiece Thickness (mm)	Welding Position		Wire Speed Adjustment	Welding Position		Wire Speed Adjustment
		<b>A</b>	<b>B</b>	<b>C</b>	<b>A</b>	<b>B</b>	<b>C</b>
0.6 - 0.8	1	MIN	5	1	MIN	5	
0.8 - 1.0	1	MIN	6	2	MIN	6	
1.0 - 2.0	2	MIN	6	2	MAX	6	
2.0 - 3.0	2	MAX	7	2	MAX	7	
>3.0	2	MAX	7-8	2	MAX	7-8	

ALUMINIUM	0.8 mm Gas Welding Wire		
Workpiece Thickness (mm)	Welding Position		Wire Speed Adjustment
	<b>A</b>	<b>B</b>	<b>C</b>
0.8	1	MIN	6
1.0 - 2.0	2	MIN	6
2.0 - 3.0	2	MAX	7-8

## NO GAS

SOFT STEEL	0.9 mm Gas Welding Wire		
Workpiece Thickness (mm)	Welding Position		Wire Speed Adjustment
	<b>A</b>	<b>B</b>	<b>C</b>
0.6 - 0.8	1	MIN	5
0.8 - 1.0	2	MIN	6
1.0 - 1.2	2	MAX	6
1.2 - 2.0	2	MAX	7-8

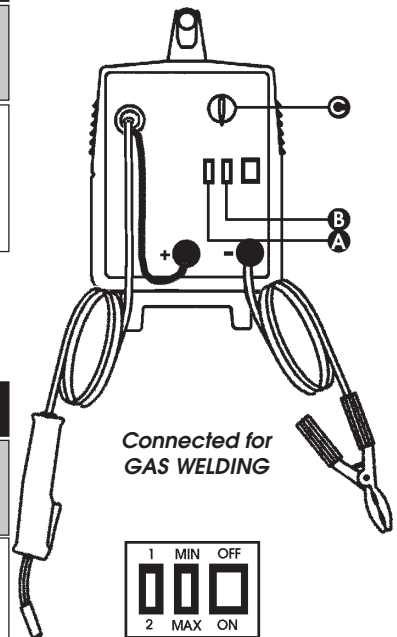

# CONTROL SETTINGS - REFERENCE TABLES


## B. MIGs 151EN

STEEL	0.6 mm Gas Welding Wire				0.8 mm Gas Welding Wire				
	Workpiece Thickness (mm)	Welding Position			Wire Speed Adjustment	Welding Position			Wire Speed Adjustment
		<b>A</b>	<b>B</b>	<b>C</b>	<b>D</b>	<b>A</b>	<b>B</b>	<b>C</b>	<b>D</b>
0.5 - 0.6	1	2/3	MIN	5					
0.6 - 0.8	A	2	MIN	5	A	2	MIN	6	
0.8 - 1.0	1	2/3	MAX	6	1	2/3	MAX	6	
1.0 - 1.2	A	3	MIN	6	1	2/3	MAX	6	
1.2 - 2.0	A	2	MAX	6	A	2	MAX	6	
2.0 - 3.0	A	3	MAX	7	A	3	MAX	7/8	
3.0 - 6.0	A	3	MAX	8	A	3	MAX	8	

ALUMINIUM	0.8 mm Gas Welding Wire			
Workpiece Thickness (mm)	Welding Position			Wire Speed Adjustment
	<b>A</b>	<b>B</b>	<b>C</b>	<b>D</b>
0.8	1	2/3	MIN	6
1.0 - 1.5	1	2/3	MAX	6
1.5 - 2.0	A	3	MAX	8
2.0 - 3.0	A	3	MIN	7/8


## NO GAS

SOFT STEEL	0.9 mm Gas Welding Wire			
Workpiece Thickness (mm)	Welding Position			Wire Speed Adjustment
	<b>A</b>	<b>B</b>	<b>C</b>	<b>D</b>
0.6 - 0.8	A	2	MIN	5
0.8 - 1.0	A	3	MIN	6
1.0 - 1.2	1	2/3	MAX	6
1.2 - 2.0	A	2	MAX	6
2.0 - 3.0	A	3	MAX	8

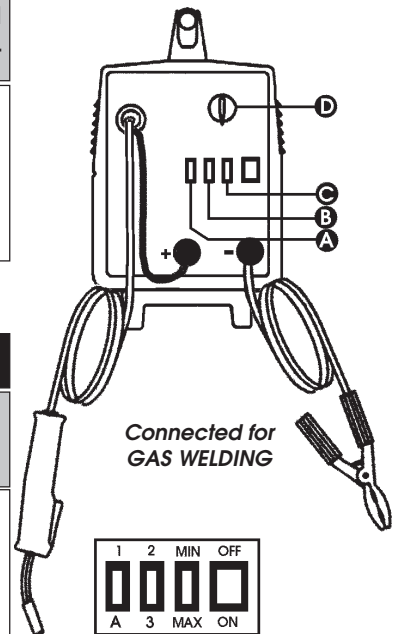


# WIRING DIAGRAMS

## MIG 90EN

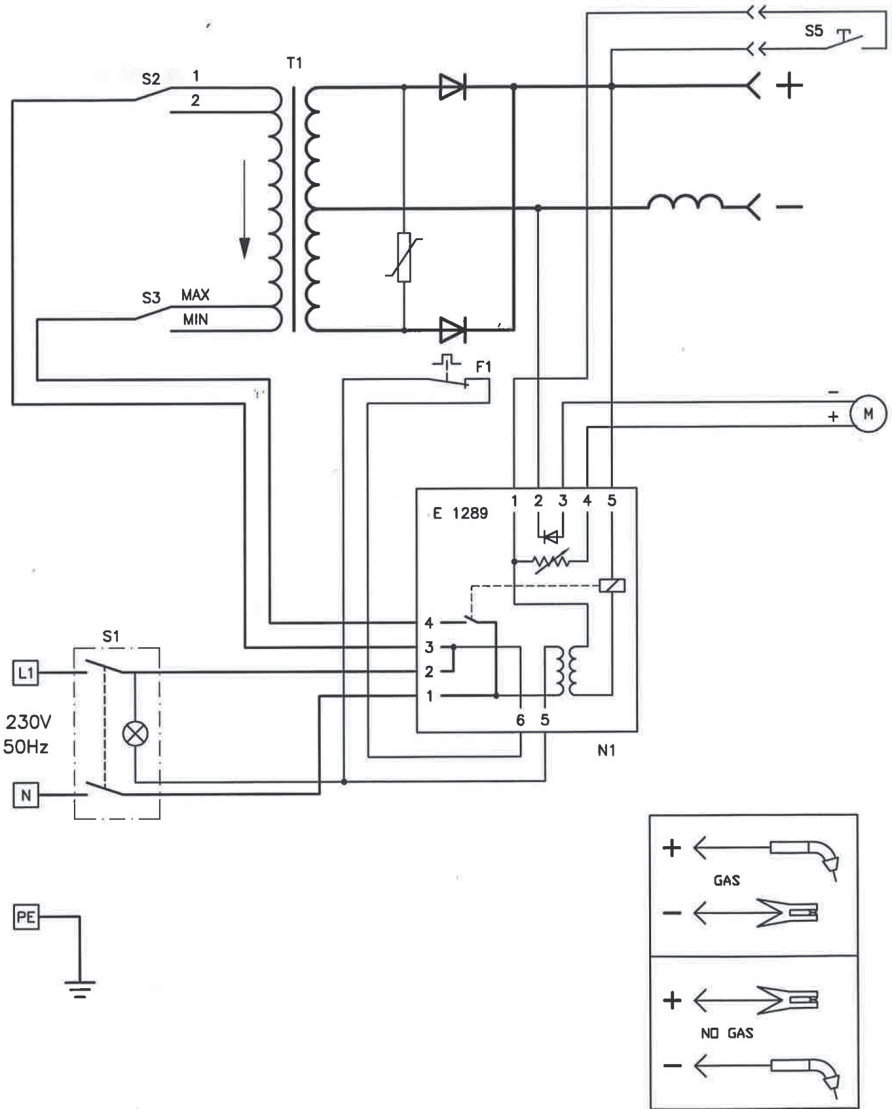


# WIRING DIAGRAMS

## MIG 100EN & 105EN

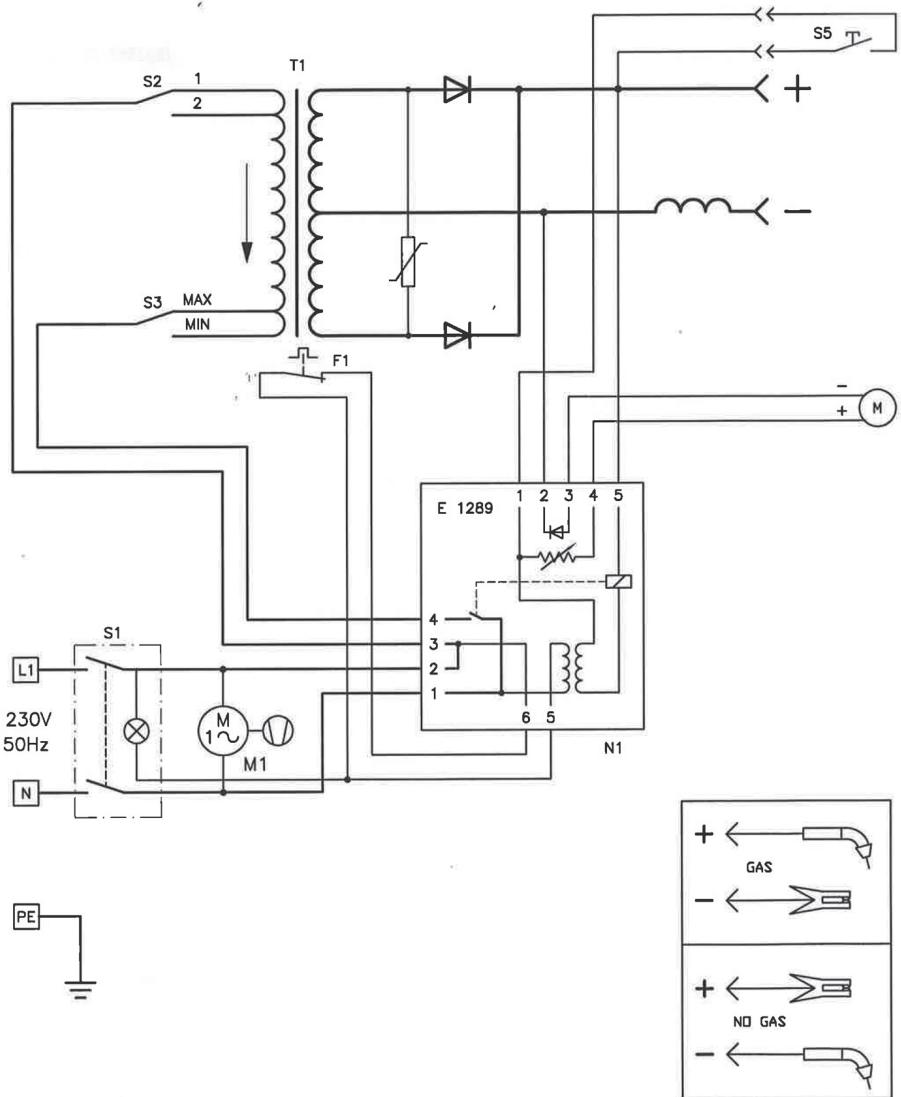


# WIRING DIAGRAMS

## MIG 151EN

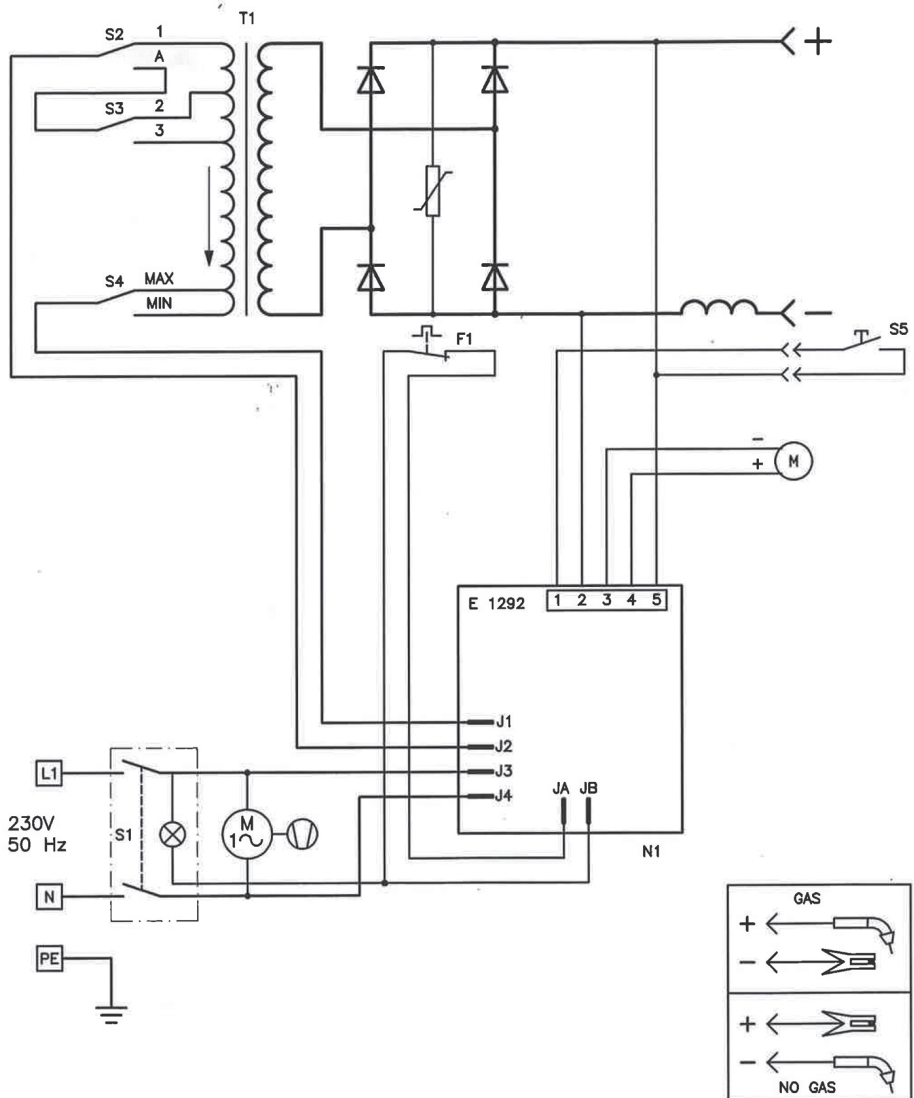

# PARTS DIAGRAM - MIG 90EN

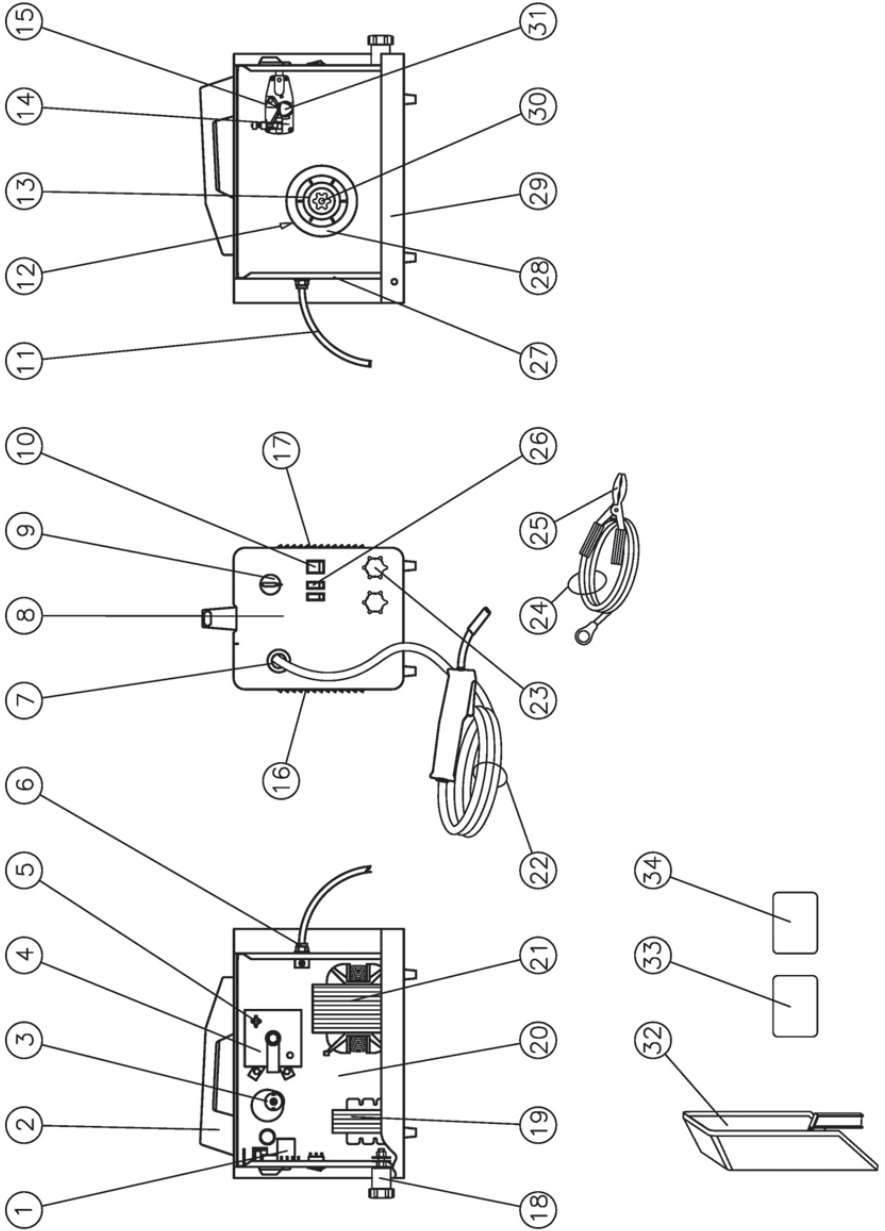




## PARTS LIST - MIG90EN

No.	Description	Part No.
01	P.C. Board	EN22710043
02	Handle	EN21600035
03	Wire Feeding Motor I 2V	EN04600143
04	Rectifier	EN22400001
05	Complete Thermostat	EN04600126
06	Cable Clamp	EN04600233
07	Torch Grommet On Front Panel	EN21690458
08	FrontPANEL	EN33710056
09	Potentiometer Knob	EN04600333
10	Amber Pilot-light Switch	EN22200022
11	Input Cable	EN20220068
12	Fixed Spool Holder	EN21690714
13	Spool Holder Retaining Ring	EN21690715
14	Plastic Wire Feeder	EN44440017
15	Ball Bearing	EN21500001
16	Left-upper Panel	EN33705614
17	Right-upper Panel	EN33705613
18	Insulating Washers	EN04600022
19	Choke	EN44135100
20	Dividing Panel	EN33721115
21	Transformer	EN44120068
22	Complete Torch	EN23000063
23	Hand-wheel	EN21800042
24	Earth Cable	EN43210041
25	Earth Clamp	EN22110043
26	Welding Current Switch	EN22200038
27	Back Panel	EN33715015
28	Flux-cored Wire Spool	<b>See accessories</b>
29	Lower Panel	EN33700308
30	Spool Holder Handwheel	EN21800069
31	Wire Feed Roll	EN33805074
32	Welding Maskw/handle	EN21905065
33	Transparent Glass	EN21905020
34	Dark Glass Din 11	EN2190S021


# PARTS DIAGRAM - MIG 100EN & 105EN

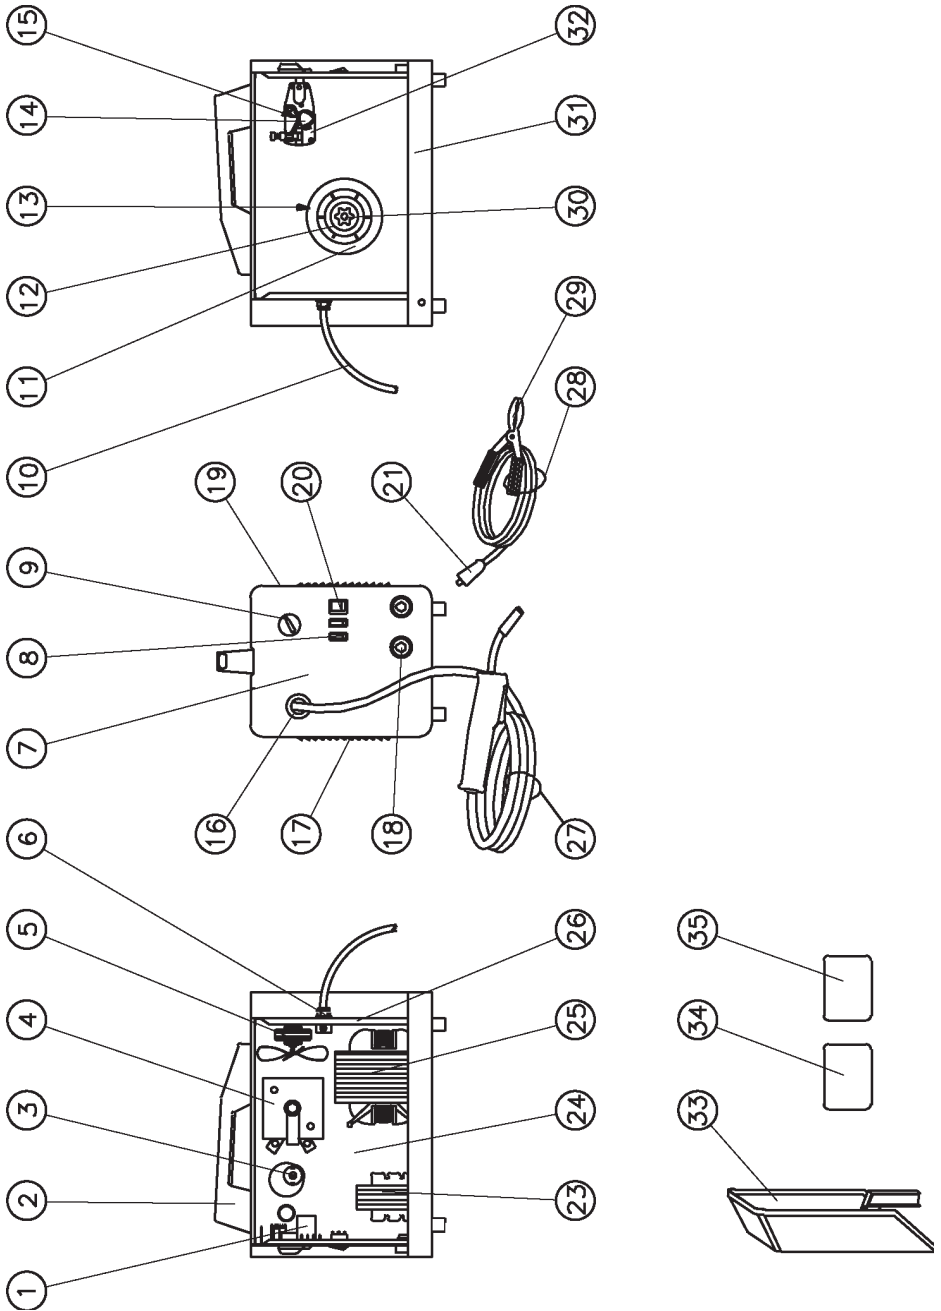

## PARTS LIST - MIG100EN & 105EN

No.	Description	Part No.
01	P.C. Board	EM22710043
02	Handle	EM21600035
03	Wire Feeding Motor	EM22810001
04	Rectifier	EM22400001
05	Complete Fan	EM04600055
06	Cable Clamp	EM21605010
07	Front Panel	EM33710056
08	Welding Current Switch	EM22200038
09	Potentiometer Knob	EM21690310
10	Input Cable	EM20220068
11	Flux-cored Wire Spool	<b>See Accessories</b>
12	Spool Holder Retaining Ring	EM21690715
13	Fixed Spool Holder	EM21690714
14	Wire Feed Roll	EM33805074
15	Ball Bearing	EM21500001
16	Torch Grommet On Front Panel	EM21690458
17	Left-upper Panel	EM33705614
18	Female Dinse Plug	EM22100002
19	Right-upper Panel	EM33705613
20	Amber Pilot-light Switch	EM22200022
21	Dinse Plug	EM22100001
23	Choke	EM44135001
24	Dividing Panel	EM33720115
25	Transformer W/ Thermostat <b>(MIG 100EN)</b>	EM44120068
25	Transformer W/ Thermostat <b>(MIG 105EN)</b>	EM44120089
26	Back Panel	EM33715015
27	Complete Torch	EM23000014
28	Earth Cable	EM43210006
29	Earth Clamp	EM22110047
30	Spool Holder Handwheel	EM21800069
31	Lower Panel	EM33700308
32	Plastic Wire Feeder	EM44400017
33	Welding Mask with Handle	EM21905065
34	Transparent Glass	EM21906020
35	Dark Glass Bs Din li	EM21906021

# PARTS DIAGRAM - MIG 151TE

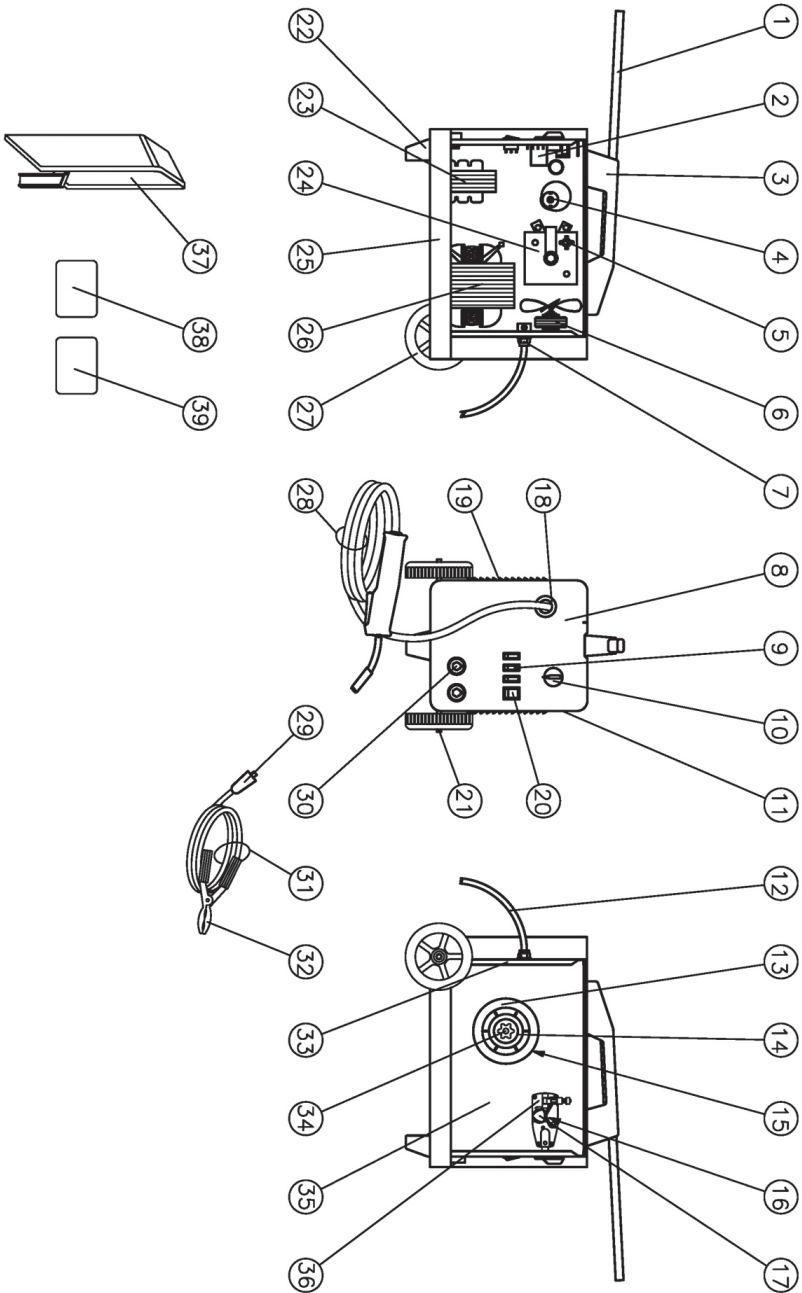

# PARTS LIST - MIG151TE

No.	Description	Qty	Part No	Part No.
01	Handle-Extension	1	EN33725071	9005
02	P.C. Board	1	EN22710043	
03	Handle	1	EN 21600035	
04	Wire Feeding Motor	1	EN 04600143	
05	Complete Thermostat	1	EN 04600126	
06	Complete Fan	1	EN 04600055	
07	Cable Clamp	1	EN4600233	
08	Front Panel Black	1	EN33710056	9005
09	High/Low Power Switch	3	EN 22200038	
10	Red Knob	1	EN4600333	
11	Right Side Panel	1	EN33705613	5015
12	Input Cable	1	EN 20220068	
13	Flux-Cored Wire Spool	1	EN 21910028	
14	Spool Holder Retaining Ring	1	EN 21690012	
15	Fixed Spool Holder	1	EN 21690011	
16	Ball Bearing	1	EN 21500001	
17	Wire Feed Roll	1	EN 33805074	
18	Torch Grommet	1	EN21690458	
19	Left Side Panel	1	EN33705614	5015
20	Yellow Pilot-Light Switch	1	EN 22200022	
21	Wheels Axle	1	EN 55200033	
22	Plastic Foot	1	EN 21610009	
23	Choke	1	EN 44135123	
24	Rectifier	1	EN22400049	
25	Lower Panel Blue	1	EN33700308	5015
26	Transformer	1	EN 44120086	
27	Wheel	2	EN 21625034	
28	Torch Gas-Nogas Rubber Liner	1	EN 23000064	
29	Dinse Plug	1	EN 22100001	
30	Female Dinse Plug	2	EN 22100002	
31	Earth Cable	1	EN 43210006	
32	Earth Clamp	1	EN22110005	
33	Back Panel	1	EN33715015	5015

## ACCESSORIES

The following accessories are available from your Clarke dealer. Please quote the part numbers shown below:

### 1. Welding Wire Spools

	Mild Steel	Stainless Steel	Aluminium
Mini - 0.6mm	6000641	-	-
Mini - 0.8mm	6000481	6000498	6000483
Mini - 9mm (FLUX Core)	6000664	-	-
5kg - 0.6mm	6000476	-	-
5kg - 0.8mm	6000475	-	-
4.5-5kg - 9mm (FLUX Core)	6000666	-	-

### 2. Welding Gas

CO <sub>2</sub> (250g)	6000642	For welding Mild Steel
CO <sub>2</sub> (600g)	6000643	For welding Mild Steel
Argon	6000661	For welding Aluminium
CO <sub>2</sub> /Argon Mix	6000660	For welding Stainless/Thin Sheet MS

### 3. Welding Tips

0.6mm (pack of 5)	8132260
0.8mm (pack of 5)	8132270
1.0mm (pack of 5)	8132040

### 4. Gas Regulator

8132000

In addition to the above, your Clarke dealer can provide you with a wide range of welding accessories, safety equipment etc., to increase productivity where necessary and to simplify and assist in the welding process.

## PARTS AND SERVICE CONTACTS

For Spare Parts and Service, please contact your nearest dealer,  
or CLARKE International, on one of the following numbers.

**PARTS & SERVICE TEL: 020 8988 7400**

**PARTS & SERVICE FAX: 020 8558 3622**

**or e-mail as follows:**

**PARTS: [Parts@clarkeinternational.com](mailto:Parts@clarkeinternational.com)**

**SERVICE: [Service@clarkeinternational.com](mailto:Service@clarkeinternational.com)**

# SPECIFICATIONS

	90EN	100EN	105EN	151TE
Power Supply	230V 50Hz 1Ph	230V 50Hz 1Ph	230V 50Hz 1Ph	230V 50Hz 1Ph
Fuse Rating	13Amps	13Amps	13Amps	13Amps
Current Range	30-90A	30-100A	30-100A	30-150A
Max. Metal Thickness	3-4mm	4-5mm	4-5mm	5-6mm
Welding Wire Sizes	0.6-0.9mm	0.6-0.9mm	0.6-0.9mm	0.6-0.9mm
Duty Cycle* 8%	80A	-	-	-
15%	-	100A	90A	130A
60%	30A	55A	48A	62A
100%	24A	40A	37A	48A
Dimensions	430X250X370mm	430X250X370mm	430X250X370mm	700X320X580mm
Weight	23kg	28kg	22kg	25kg
Part No.	6010107	6010103	6014010	6014100

\* Duty Cycle: Determines the machine 'down time'.

eg MIG100-EN, operating at 55 Amps - Duty Cycle - 60%. This means that in ANY 10 minute period, the machine may operate for 6 minutes and must have a down time of 4 minutes.

Please note that the details and specifications contained herein, are correct at the time of going to print. However, CLARKE International reserve the right to change specifications at any time without prior notice.  
**ALWAYS CONSULT THE MACHINE'S DATA PLATE**

# A SELECTION FROM THE VAST RANGE OF

# Clarke®

## QUALITY PRODUCTS

### AIR COMPRESSORS

From DIY to industrial, Plus air tools, spray guns and accessories.

### GENERATORS

Prime duty or emergency standby for business, home and leisure.

### POWER WASHERS

Hot and cold, electric and engine driven - we have what you need

### WELDERS

Mig, Arc, Tig and Spot. From DIY to auto/industrial.

### METALWORKING

Drills, grinders and saws for DIY and professional use.

### WOODWORKING

Saws, sanders, lathes, mortisers and dust extraction.

### HYDRAULICS

Cranes, body repair kits, transmission jacks for all types of workshop use.

### WATER PUMPS




Submersible, electric and engine driven for DIY, agriculture and industry.

### POWER TOOLS

Angle grinders, cordless drill sets, saws and sanders.

### STARTERS/CHARGERS

All sizes for car and commercial use.

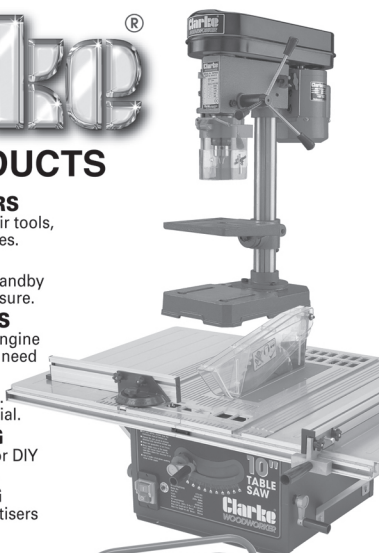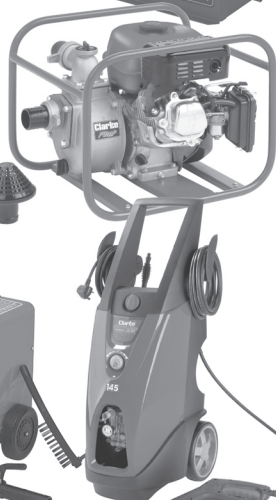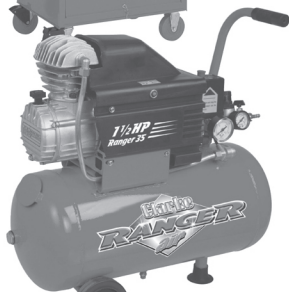

**PARTS & SERVICE: 020 8988 7400**

**E-mail: [Parts@clarkeinternational.com](mailto:Parts@clarkeinternational.com) or [Service@clarkeinternational.com](mailto:Service@clarkeinternational.com)**

**SALES: UK 01992 565333 or Export 00 44 (0)1992 565335**

**Clarke®** INTERNATIONAL Hemnall Street, Epping, Essex CM16 4LG  
[www.clarkeinternational.com](http://www.clarkeinternational.com)